

Order Code	Description						
FXS1	PosiTector Standard with 6000 FXS Probe						
FXS3	PosiTector Advanced with 6000 FXS Probe						

PosiTector[®] 6000 Coating Thickness Gage

Compare PosiTector Gage Bodies

Standard	Advanced
•	•
	•
•	•
•	•
•	•
250 per probe	100,000 in up to 1,000 batches
	•
	•
	•
	•
	•
•	•
	•
	•
	•



Removeable Cabled Probe	Probe Model FXS Xtreme™					
	Pango	0 - 80 mils				
1.2"	nanye.	0 - 2000 µm				
30mm		± (0.05 mils + 1%) 0 - 2 mils ± (0.1 mils + 1%) > 2 mils				
Ø16mm / 0.6"	*Accuracy:	± (1 μm + 1%) 0 - 50 μm ± (2 μm + 1%) > 50 μm				
	Cabled Probe	Cabled Probe Range: *Accuracy:				

Accuracies are stated as a fixed value plus a percentage of the gage's actual reading.

*FXS Xtreme*TM probe for measuring non-magnetic coatings on steel substrates. Our most rugged cabled probe with an Alumina wear face and braided cable – ideal for rough or hot surfaces up to 250° C (500° F).

©DeFelsko Corporation USA 2017. All Rights Reserved. Technical Data subject to change without notice. • P6000.v.LW/W1710



DeFelsko Corporation 800 Proctor Ave., Ogdensburg, New York 13669-2205 USA **Toll Free 1-800-448-3835** • Tel: +1-315-393-4450 • Fax: +1-315-393-8471 techsale@defelsko.com • www.defelsko.com





All Gages Feature...

Simple

- **NEW** Faster measurement speed 60+ readings per minute
- Ready to measure no adjustment required for most applications
- Enhanced one-handed menu navigation
- Flashing display ideal in a noisy environment
- RESET feature instantly restores factory settings

Accurate

- Certificate of Calibration showing traceability to NIST or PTB included (Long Form)
- · Built-in temperature compensation ensures measurement accuracy
- Hi-RES mode increases displayed resolution for use on applications that require greater precision
- Conforms to national and international standards including ISO and ASTM

Versatile

- Multiple Calibration adjustment options including 1 point, 2 point, known thickness, average zero
- Selectable display languages
- High contrast LCD with backlit display
- Flip display enables right-side-up viewing
- Extended cables available (up to 75 m/250 ft) for underwater or remote measuring
- Uses alkaline or rechargeable batteries (built-in charger)

Order Code	Description
FXS1	PosiTector Standard with 6000 FXS Probe
FXS3	PosiTector Advanced with 6000 FXS Probe

Durable

- · Solvent, acid, oil, water and dust resistant weatherproof
- Wear-resistant probe tip
- · Shock-absorbing, protective rubber holster with belt clip
- Two year warranty on gage body AND probe



Statistics mode continually displays/updates average, standard deviation, min/max thickness and number of readings while measuring

- Screen Capture Save screen images for record keeping and review
- HiLo alarm audibly and visibly alerts when measurements exceed user-specified limits
- **NEW** Enhanced FAST mode 90+ readings per minute for quick inspection
- Sealed USB port for fast, simple connection to a PC and to supply continuous power. USB cable included.
- · Software updates via web keep your gage current
- · Every stored measurement is date and time stamped
- Software Solutions for viewing, analyzing & reporting data. See page 3 for a complete overview of these options.





Comes complete with PosiTector gage body, FXS probe, precision plastic shim(s), protective rubber holster with belt clip, wrist strap, 3 AAA alkaline batteries, instructions, protective lens shield, convenient carrying case, Long Form Certificate of Calibration traceable to NIST or PTB, USB cable, PosiSoft Software, two (2) year warranty.

SIZE: 137 x 61 x 28 mm (5.4" x 2.4" x 1.1")

BODY WEIGHT: 140 g (4.9 oz.) without batteries

CONFORMS TO: ISO 2178/2360/2808, ISO 19840, ASTM B244/B499/D1186/D1400/D7091/E376/G12, BS3900-C5, SSPC-PA2 and others

©DeFelsko Corporation USA 2017. All Rights Reserved. Technical Data subject to change without notice. • P6000.v.LW/W1710



DeFelsko Corporation 800 Proctor Ave., Ogdensburg, New York 13669-2205 USA **Toll Free 1-800-448-3835** • Tel: +1-315-393-4450 • Fax: +1-315-393-8471 techsale@defelsko.com • www.defelsko.com



PosiSoft[®] Suite of Software

Four FREE and unique ways to view and report your PosiTector and PosiTest data

PosiSoft Desktop — PC/Mac

Powerful desktop software for downloading, viewing, printing and archiving measurement data. No internet connection required.

- Import readings directly from the gage via USB or from legacy PosiSoft desktop versions
- Synchronize measurement data including readings, notes and pictures to and from PosiSoft.net
- Import/Export Templates and Jobs to share with other users
- Import PDF forms and overlay Custom Fields for automatic population of inspection and measurement data
- Report preview automatically refreshes as changes are made



Prompted Batch Mode

Create pre-defined batches with onscreen text and image prompts for each reading and upload to PosiTector 6000 gages (Advanced models only).

- Ideal for ensuring a consistent measurement pattern for repetitive jobs or when specific measurement locations are required
- Create and store multiple templates for different jobs

PosiSoft.net — Web-based

A web-based application offering secure centralized management of readings. Access your data from any web-connected device.

- Synchronize data when connected via USB or WiFi
- Synchronize measurement data including readings, notes and pictures with PosiSoft Desktop and PosiTector App
- Securely store measurement data in the cloud and share with authorized users via a secure login

osiSoff®													The Description of
							0 100 0001			-			
-	10000-000000	-			1.41	ference.	170	teasy.	1444			2443	(actri)
	Salas Polis Januar		 *		299.83	Constant la	044						Design in the second se
<u></u>	******	0349.0		2	22	Calabian B.		1992	NORE			pera	DEPENDENT AL
104170	(epochen				**	Course or		10007	1000			0440	SISTS (
04001		Calculate Press			-	Course 7.		2000	1666			22 min	211112
legtor (eps					0000	Andrew M.		1000	1008			27 min	increase in
Investrian Once Incentional					UNITERM	Arrenter 15		1992					December 24
													Doordier 24 August a 12 AU
Darya Drul												25ea	December 21
LAWRENCE										0		24410	31716
													20100
00000005											12	2249	(margar 2),
												2740	Description 24
OCCUPATION AND ADDRESS OF													21150
											18	20 min	And the local
													incretter 21
													Increase in the state of the st
											10	2049	Concerning 21, ANY A STREET
												77.40	Distance 25

PosiSoft USB Drive — Gage Based



A simple gage interface to retrieve data in a manner similar to USB flash drives, cameras, or digital audio players. No software to install or internet connection required.

PosiTector App — Mobile

Mobile app connects PosiTector Advanced instruments, the PosiTector SmartLink and the PosiTest AT-A to your iOS or Android smart device.

- Auto pairing Bluetooth BLE connection
- Automatically generate user-formatted reports and share via email, text, cloud storage services like Dropbox, and more
- Export readings to PosiSoft Desktop or synchronize readings to and from PosiSoft.net for further reporting and archival options




PosiSoft Custom PDF Report Generator

Easily create reports from your measurement data in seconds.

featured on **PosiSoft Desktop** PosiSoft.net **PosiTector App**

 Include inspection information such as on-site pictures, screen captures, notes and more to communicate important details

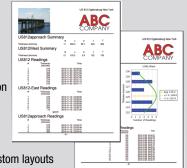

- Create and save multiple custom layouts as templates - insert cover pages, add logos/images, and select font and point size
- Select the information to include for each product type charts, histograms, readings, time stamps and more
- instrument types
- Export readings as comma separated value (.CSV) files which can easily be imported into Excel and other supporting applications



Jobs feature consolidates batches into groups to keep measurement data organized and to guickly create multibatch reports (not available on PosiTector App)

- View and print readings and graphs using universal PC/Mac web browsers and file explorers
- Measurement data can be printed quickly from a formatted HTML report or exported in .CSV format for further analysis in spreadsheets
- Simple file management Copy and paste measurement data from the PosiTector to a local folder on your computer, network folder or cloud drive

PosiTector Developer Resources

including Bluetooth 4.0, WiFi,

USB Keyboard, and USB Serial

Access stored screen captures (snapshots) of the PosiTector display



PosiTector and PosiTest AT-A instruments can integrate with third-party software, drones, ROVs, PLCs, and robotic devices using several industrystandard communication protocols.

The Measure of Quality

DeFelsko Corporation • 800 Proctor Ave. • Ogdensburg, New York 13669-2205 USA Toll Free 1-800-448-3835 • Tel: +1-315-393-4450 • Fax: +1-315-393-8471 techsale@defelsko.com • www.defelsko.com



©DeFelsko Corporation USA 2019. All Rights Reserved. Technical Data subject to change without notice. Printed in USA. PSoft.v.LW/W1908

- Compile multi-batch reports from one or more probes and